

SERVICE BULLETIN – 01/NOVEMBER 2009


SPN 605

NEW HIGHER FREEZER UPPER & BOTTOM FLANGES

Starting from the following Serial Number:

SPN 605 s/n ZD 2038

The upper and bottom S.S. flanges of the freezer have been changed with thicker ones (we move from 5 to 8 mm thickness as shown on the bottom photos)

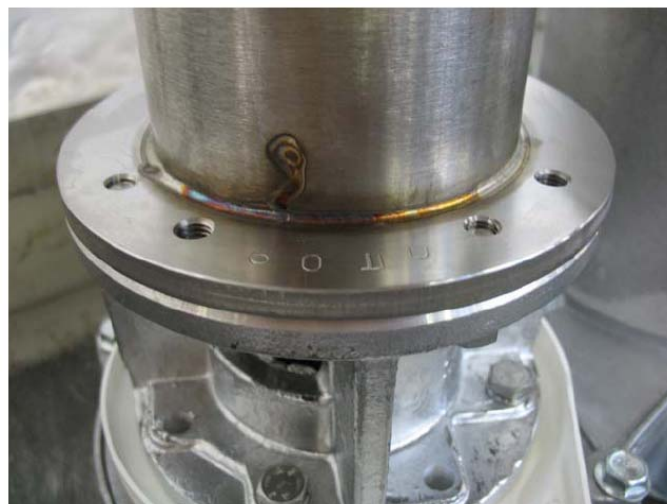

so to proper assure the perpendicularity between the gear reducer top cover and the freezer and have the perfect alignment between the gear motor output shaft and the auger shaft.

The new worm tube as well as the new freezer assembly are available under the same part numbers of the former ones and they are perfectly exchangeable with them.

From the same serial numbers we have also relocate the outlet of the capillary tube from the suction line so to avoid any possible contact/friction with compressor or the left side panel of the machine as shown on the here below photo.

